UTAH STATE CAPITOL ARCHITECTURE: INTERIOR PRESERVATION ZONE II SURVEY REPORT

Notes

108 State Auditor's 107/109 Lunch Room

Dimension/S F

Original Use Auditor's vault



Element	Description	Historical Significance	Notes
WN-11	Metal transom, louvered	Non-Contributory Qnty:	
B-1	Gray marble base, 12" polished	Very Significant Qnty:	
B-4	Rubber/vinyl base	Non-Contributory Qnty:	
CL-08	Acoustical ceiling, suspended T-bar frame	Non-Contributory Qnty:	
CPP-7	Plaster pilaster, painted	Significant Qnty:	
D-09	Wood slab door with decorative metal-wood grained casing, transom above	Contributory Qnty:	
D-13	Metal wood-grained panel door with matching casing. Bankers glass panels	Contributory Qnty:	
F-12	Carpeted floor, glue-down	Contributory Qnty:	
H-1	Brass door handle, modern	Contributory Qnty:	
L-08	Fluorescent lights	Non Contributory Qnty:	
M-16	Marble window sill, original, with molded wood skirt	Contributory Qnty:	

M-21	Metal casing, new	Non Contributory Qnty:
M-6	Metal wood-grained casing w/ fancy profile	Non-Contributory Qnty:
W-18	demountable wall	Non Contributory Qnty:
W-8	Sheetrock wall, painted and smooth	Contributory Qnty:
WN-1	Aluminum replacement window	Non Contributory Qnty:

113 Office of the First Lady

Dimension/S F 26'-0" x 18'-2"

Original Use Café walk-in refrigerator

Preservation Level II 2



Element	Description	Historical Significance	Notes
B-4	Rubber/vinyl base	Non-Contributory Qnty:	
B-7	Marble base block	Significant Qnty:	
CL-08	Acoustical ceiling, suspended T-bar frame	Non-Contributory Qnty:	
D-09	Wood slab door with decorative metal-wood grained casing, transom above	Contributory Qnty:	with H-1
F-12	Carpeted floor, glue-down	Contributory Qnty:	
L-08	Fluorescent lights	Non-Contributory Qnty:	
W-8	Sheetrock wall, painted and smooth	Contributory Qnty:	the connecting wall with room 111 is not dry wall - may be covered with, but thickness indicates stone - ooalite possibly

Notes connects to room 113 - also called office of the First Lady

121e vault

Dimension/S F

Original Use

2 Preservation Level II



Element	Description	Historical Significance	Notes
B-4	Rubber/vinyl base	Non-Contributory Qnty:	
E-12	electrical box	Non-Contributory Qnty:	security
F-12	Carpeted floor, glue-down	Contributory Qnty:	broadloom
MS-3	Fire hose cabinet, glass, metal, recessed in wall	Non-Contributory Qnty: 2	
SP-10	Furniture now NHF	Non-Contributory Qnty:	steelmaster
SP-3	Wood bookcase, built-in	Non-Contributory Qnty:	s
CL-08	Acoustical ceiling, suspended T-bar frame	Non-Contributory Qnty:	in hall area
CL-09	Concrete ceiling	Contributory Qnty:	
D-04	Wood panel door, decorative metal wood- grained casing, transom above	Significant Qnty:	with M-6, painted white and H-3
F-16	Concrete floor, painted	Non-Contributory Qnty:	
L-08	Fluorescent lights	Non-Contributory Qnty:	
W-6	Concrete wall	Non-Contributory Qnty:	
W-8	Sheetrock wall, painted and smooth	Contributory Qnty:	in hall area

164 G.O.P.B.

Dimension/S F

Original Use

Vestibule: Cold air chamber



Notes

Element	Description	Historical Significance	Notes
B-1	Gray marble base, 12" polished	Very Significant Qnty:	
B-4	Rubber/vinyl base	Non-Contributory Qnty:	
CL-08	Acoustical ceiling, suspended T-bar frame	Non-Contributory Qnty:	
D-09	Wood slab door with decorative metal-wood grained casing, transom above	Contributory Qnty:	
D-13	Metal wood-grained panel door with matching casing. Bankers glass panels	Contributory Qnty:	
F-12	Carpeted floor, glue-down	Contributory Qnty:	
H-1	Brass door handle, modern	Contributory Qnty:	
L-08	Fluorescent lights	Non Contributory Qnty:	
M-16	Marble window sill, original, with molded wood skirt	Contributory Qnty:	
M-6	Metal wood-grained casing w/ fancy profile	Non-Contributory Qnty:	
W-2	Oolite slab wall, painted	Very Significant Qnty:	
W-7	Plaster wall, painted and smooth	Contributory Qnty:	
WN-1	Aluminum replacement window	Non Contributory Qnty:	
WN-7	Wood transom	Contributory Qnty:	

203f Lieutenant Governor - Vault

Dimension/S F 37'-1 1/2" x 13'-6

Original Use Secretary of State

vault

Preservation Level II



Element	Description	Historical Significance Notes
B-4	Rubber/vinyl base	Non-Contributory Qnty:
CL-04	Plaster ceiling, smooth, flat, painted	Non-Contributory Qnty:
CPP-7	Plaster pilaster, painted	Significant Qnty: 6
F-11	Carpeted floor, on pad	Contributory Qnty:
L-81	Parabolic	Non-Contributory Qnty: 6
SP-17	steel mezzanine, for file storage, with glass floor	Contributory Qnty:
W-7	Plaster wall, painted and smooth	Contributory Qnty:

Notes no vents seen; no door


205a **Governor's Private Entry Hall**

Dimension/S F

Original Use

Governor's Private Entry Hall

Preservation Level II

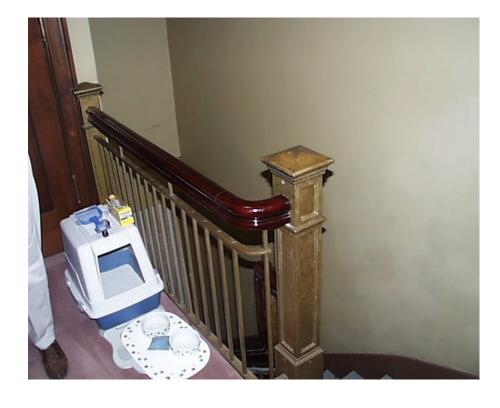

Notes includes 205 b - same entry

Element	Description	Historical Significance	Notes
F-21	tile floor - small square	Contributory Qnty:	
P-10	Toilet, Non-original	Contributory Qnty:	
P-13	Porcelain sink	Contributory Qnty:	
B-4	Rubber/vinyl base	Non-Contributory Qnty:	
CL-07	Acoustical tile ceiling, glue-on	Non-Contributory Qnty:	dropped
D-25	Wood panel door with decorative wood casing	Contributory Qnty: 1	faux bois, either side of vestibule/hall. Door to office ha a vent.
F-11	Carpeted floor, on pad	Contributory Qnty:	a voin.
ST-3	wood handrail	Contributory Qnty:	
ST-6	Concrete tread, painted	Contributory Qnty:	
ST-7	Metal post, painted	Contributory Qnty: 3	
ST-8	Metal balustrade, non-ornamental	Contributory Qnty:	
W-14	Wallpapered wall	Non-Contributory Qnty:	

211 **Auditors 207/211**

Dimension/S F

Original Use Business office

Preservation Level II 2



Notes includes 211a,b,d - B used to be restrooms,

Element	Description	Historical Significance	Notes
CL-08	Acoustical ceiling, suspended T-bar frame	Non Contributory Qnty:	
L-08	Fluorescent lights	Non Contributory Qnty:	
M-11	Wood chair rail	Contributory Qnty:	Painted
M-16	Marble window sill, original, with molded wood skirt	Significant Qnty:	
M-19	Wood casing, new	Contributory Qnty:	Painted
W-7	Plaster wall, painted and smooth	Contributory Qnty:	
WN-1	Aluminum replacement window	Non Contributory Qnty:	
WN-6	Interior sidelight window, wood	Non Contributory Qnty:	
D-10	Metal wood-grained panel door with matching casing. Bankers glass panel and transom	Very Significant Qnty:	Double doors, main entry - with marble threshold
D-15	Wood slab door with plain wood casing (simple closet/demountable doors)	Non Contributory Qnty:	
B-2	Molded wood base	Contributory Qnty:	
F-11	Carpeted floor, on pad	Contributory Qnty:	
W-8	Sheetrock wall, painted and smooth	Contributory Qnty:	
W-18	demountable wall	Non Contributory Qnty:	Painted
D-23	Wood slab door with decorative wood casing	Non Contributory Qnty:	

211c **Auditors 207/211**

Dimension/S F

Original Use

Auditing/proof reading

Preservation Level II 2



Element	Description	Historical Significance	Notes
CL-08	Acoustical ceiling, suspended T-bar frame	Non Contributory Qnty:	
D-11	Metal wood-grained panel door with matching casing. Plain louver transom	Contributory Qnty:	
L-08	Fluorescent lights	Non Contributory Qnty:	
M-11	Wood chair rail	Contributory Qnty:	Painted
M-16	Marble window sill, original, with molded wood skirt	Significant Qnty:	
M -19	Wood casing, new	Contributory Qnty:	Painted
W-18	demountable wall	Non Contributory Qnty:	
W-7	Plaster wall, painted and smooth	Very Significant Qnty:	
WN-1	Aluminum replacement window	Non Contributory Qnty:	
D-23	Wood slab door with decorative wood casing	Contributory Qnty:	
WN-6	Interior sidelight window, wood	Non Contributory Qnty:	
B-2	Molded wood base	Contributory Qnty:	
F-3	Original wood floor: maple	Significant Qnty:	Possibly not historic - but appears to be "real"
W-8	Sheetrock wall, painted and smooth	Contributory Qnty:	




211e **Auditors 207/211**

Dimension/S F

Original Use vault

Preservation Level II 2

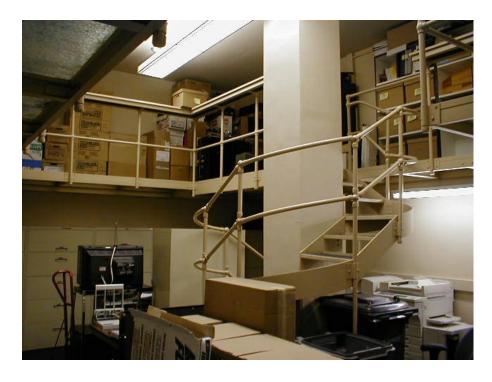

Element	Description	Historical Significance	Notes
F-12	Carpeted floor, glue-down	Non Contributory Qnty:	
B-4	Rubber/vinyl base	Non Contributory Qnty:	
M-19	Wood casing, new	Contributory Qnty:	Casing over 1 foot opening - no door.
SP-17	steel mezzanine, for file storage, with glass floor	Non contributory Qnty:	
L-81	Parabolic	Non Contributory Qnty:	
W-7	Plaster wall, painted and smooth	Contributory Qntv:	



215a **State Treasurer - Office Vault**

Dimension/S F

Original Use Treasurer's vault



Notes

Element	Description	Historical Significance	Notes
CL-09	Concrete ceiling	Very Significant Qnty:	
E-12	electrical box	Non Contributory Qnty:	various
D-13	Metal wood-grained panel door with matching casing. Bankers glass panels	Contributory Qnty:	
CPP-10	Concrete	Contributory Qnty:	
F-12	Carpeted floor, glue-down	Contributory Qnty:	
L-08	Fluorescent lights	Non Contributory Qnty:	

215b **State Treasurer - Office Vault Storage**

Dimension/S F

Original Use Vault stair

Preservation Level II 2



Element	Description	Historical Significance	Notes
L-27	Ceiling Light - simple bulb	Very Significant	Bulb is hanging
		Qnty:	down from Ligh by string.
D-30	Aluminum doors with glass panels and	Very Significant	
	matching transoms. Swing doors to patio in corner offices.	Qnty:	
L-08	Fluorescent lights	Non Contributory	
		Qnty:	
M-16	Marble window sill, original, with molded wood	Contributory	
	skirt	Qnty:	
WN-1	Aluminum replacement window	Non Contributory	
		Qnty:	

215c **State Treasurer Offices**

Dimension/S F

Original Use

Bank Commissioner's

Preservation Level II 2

vault



Notes

Element	Description	Historical Significance	Notes
E-14	fan	Non Contributory Qnty:	
W-8	Sheetrock wall, painted and smooth	Contributory Qnty:	
W-7	Plaster wall, painted and smooth	Very Significant Qnty:	
B-2	Molded wood base	Contributory Qnty:	
CL-08	Acoustical ceiling, suspended T-bar frame	Non Contributory Qnty:	
CPP-10	Concrete	Contributory Qnty:	
F-12	Carpeted floor, glue-down	Contributory Qnty:	
L-08	Fluorescent lights	Non Contributory Qnty:	
D-15	Wood slab door with plain wood casing (simple closet/demountable doors)	Non Contributory Qnty:	
SP-3	Wood bookcase, built-in	Non Contributory Qnty:	

300a **House Hallway**

Dimension/S F

Original Use House hallway Preservation Level II



Element	Description	Historical Significance	Notes
F-12	Carpeted floor, glue-down	Contributory	Non Original,
		Qnty:	placed in last renovation. Good Condition overall.
W-8	Sheetrock wall, painted and smooth	Contributory	
		Qnty:	
D-11	Metal wood-grained panel door with matching	Contributory	Good
	casing. Plain louver transom	Qnty:	reproduction - possibly with original hardware
CL-08	Acoustical ceiling, suspended T-bar frame	Non Contributory	
		Qnty:	
L-08	Fluorescent lights	Non Contributory	
		Qnty:	
L-14	Recessed lights	Non Contributory	
		Qnty:	

300c **House of Representatives Work Room**

Dimension/S F

Original Use Work Room



Notes Includes 300b

Element	Description	Historical Significance	Notes
B-4	Rubber/vinyl base	Non-Contributory Qnty:	
CL-08	Acoustical ceiling, suspended T-bar frame	Non-Contributory Qnty:	
D-11	Metal wood-grained panel door with matching casing. Plain louver transom	Contributory Qnty:	
E-12	electrical box	Non-Contributory Qnty:	300b only
F-11	Carpeted floor, on pad	Contributory Qnty:	
HC-10	vent	Non-Contributory Qnty:	300b only
L-08	Fluorescent lights	Non-Contributory Qnty:	
D-01	Wood panel door, decrative wood casing with transom.	Contributory Qnty:	
W-7	Plaster wall, painted and smooth	Non-Contributory Qnty:	



300c **House of Representatives Work Room**

Dimension/S F

Original Use Work Room



Notes Includes 300b


Element	Description	Historical Significance	Notes
B-4	Rubber/vinyl base	Non-Contributory Qnty:	
CL-08	Acoustical ceiling, suspended T-bar frame	Non-Contributory Qnty:	
D-11	Metal wood-grained panel door with matching casing. Plain louver transom	Contributory Qnty:	
E-12	electrical box	Non-Contributory Qnty:	300b only
F-11	Carpeted floor, on pad	Contributory Qnty:	
HC-10	vent	Non-Contributory Qnty:	300b only
L-08	Fluorescent lights	Non-Contributory Qnty:	
D-01	Wood panel door, decrative wood casing with transom.	Contributory Qnty:	
W-7	Plaster wall, painted and smooth	Non-Contributory Qnty:	



322 **Work Room**

Dimension/S F

Original Use Committee Room

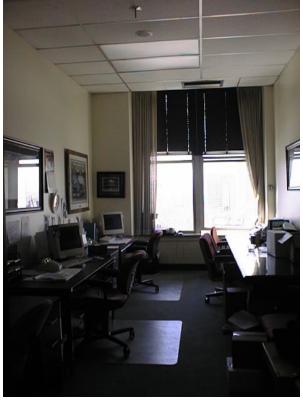

Notes Includes 324; 326; 328;330.

Element	Description	Historical Significance	Notes
B-4	Rubber/vinyl base	Non-Contributory Qnty:	
B-6	Plaster base, painted	Significant Qnty:	Along plaster wal
CL-08	Acoustical ceiling, suspended T-bar frame	Non-Contributory Qnty:	
D-26	Wood panel door with decorative metal wood- grained casing and decorative metal. Painted louvered transom	Contributory Qnty:	
F-11	Carpeted floor, on pad	Contributory Qnty:	
L-08	Fluorescent lights	Non-Contributory Qnty:	
W-7	Plaster wall, painted and smooth	Contributory Qnty:	
W-8	Sheetrock wall, painted and smooth	Contributory Qnty:	east side
WN-1	Aluminum replacement window	Non-Contributory Qnty:	
WN-11	Metal transom, louvered	Non-Contributory Qnty:	same as 330

332 **Vacant Offices**

Dimension/S F

Original Use

Committee Room

Preservation Level II 2



Notes Includes 332b

Element	Description	Historical Significance	Notes
B-6	Plaster base, painted	Very Significant Qnty:	painted
F-11	Carpeted floor, on pad	Contributory Qnty:	
W-11	Fabric wall, glue-on	Non contributory Qnty:	
W-7	Plaster wall, painted and smooth	Very Significant Qnty:	
W-8	Sheetrock wall, painted and smooth	Contributry Qnty:	
CL-07	Acoustical tile ceiling, glue-on	Significant Qnty:	
L-81	Parabolic	Non Contributry Qnty:	
D-05	Metal wood-grained panel door with matching casing	Significant Qnty:	
D-30	Aluminum doors with glass panels and matching transoms. Swing doors to patio in corner offices.	Significant Qnty:	
WN-1	Aluminum replacement window	contributory Qnty:	
D-18	Metal wood-grained panel door with matching casing. Plain louver transom	Very Significant Qnty:	Double Entry door - to cooridoor, into Entry vestibule
WS-2	Marble wainscot, polished	Very Significant Qnty:	Entry vestibule
MS-15	Broadcast station: metal/glass cabinets bolted to floor	Very Significant Qnty:	Entry vestibule
D-08	Wood slab door with decorative metal-wood grained casing	Very Significant Qnty:	Entry vestibule

332a **Vacant Offices/ Storage Room**

Dimension/S F

Original Use Clerk's vault Preservation Level II



Element	Description	Historical Significance	Notes
W-7	Plaster wall, painted and smooth		
		Qnty:	
F-14	Carpet tiles	Ontre	
		Qnty:	
CL-10	Plaster ceiling, molded and decorative	Qnty:	
D-15	Wood slab door with plain wood casing	y .	
D-13	(simple closet/demountable doors)	Qnty:	

333 **Vacant Offices**

Dimension/S F

Supreme Court offices Original Use

Preservation Level II 2



Element	Description	Historical Significance	Notes
SP-3	Wood bookcase, built-in	Contributory Qnty:	
B-6	Plaster base, painted	Significant Qnty:	
CL-08	Acoustical ceiling, suspended T-bar frame	Non-Contributory Qnty:	
WN-1	Aluminum replacement window	Non Contributory Qnty:	
L-81	Parabolic	Non Contributory Qnty:	
F-12	Carpeted floor, glue-down	Contributory Qnty:	
D-17	Wood panel door with decorative metal wood-grained casing. Glass transom	Significant Qnty:	
D-07	Wood Panel door with decorative metal wood-grained casing	Contributory Qnty:	

334 **Vacant Offices**

Dimension/S F

Original Use

Supreme Court offices

Preservation Level II 2



Element	Description	Historical Significance	Notes
W-4	Wood panelled wall	Contributory Qnty:	
B-2	Molded wood base	Contributory Qnty:	
SP-3	Wood bookcase, built-in	Non Contributory Qnty:	
D-21	Metal wood-grained panel door with matching casing. Banker glass panels in door. Plain louver transom	Significant Qnty:	all but room 334 has door 18
CL-08	Acoustical ceiling, suspended T-bar frame	Non-Contributory Qnty:	
D-02	Wood panel door, wood bollection molding casing	Contributory Qnty:	Adjoining office door
D-15	Wood slab door with plain wood casing (simple closet/demountable doors)	Significant Qnty:	Closet
D-11	Metal wood-grained panel door with matching casing. Plain louver transom	Contributory Qnty:	Main Entrance
F-12	Carpeted floor, glue-down	Contributory Qnty:	
L-08	Fluorescent lights	Non Contributory Qnty:	
WN-1	Aluminum replacement window	Non Contributory Qnty:	

Notes Includes 336; 338; 340; 342; 342a; 348; 350; 350a & 346



372a **Minority Party leader & Assistant Minority Whip**

Dimension/S F

Original Use Senate Secretary

Preservation Level II 2



Element	Description	Historical Significance	Notes
W-7	Plaster wall, painted and smooth	Very Significant Qnty:	
D-02	Wood panel door, wood bollection molding casing	Significant Qnty:	entrance door between room and 372, marble base block/
D-13	Metal wood-grained panel door with matching casing. Bankers glass panels	Very Significanct Qnty:	marble Threshold
B-2	Molded wood base	Contributory Qnty:	
CL-08	Acoustical ceiling, suspended T-bar frame	Non Contributory Qnty:	
D-05	Metal wood-grained panel door with matching casing	Contributory Qnty: 1	with M-6, B-7, H-3 to hall
F-12	Carpeted floor, glue-down	Contributory Qnty:	
L-82	Pendent Parabolic	Non Contributory Qnty:	
W-11	Fabric wall, glue-on	Contributory Qnty:	Covering East and West walls & Column
W-8	Sheetrock wall, painted and smooth	Contributory Qnty:	
WN-1	Aluminum replacement window	Non Contributory Qnty: 1 pr	with M-16



380a **Men's Restroom North - 3rd Floor**

Dimension/S F

Original Use

Men's Restroom North - 3rd Floor



Notes

Element	Description	Historical Significance	Notes
D-09	Wood slab door with decorative metal-wood grained casing, transom above	Contributory Qnty:	
CL-08	Acoustical ceiling, suspended T-bar frame	Non-Contributory Qnty:	
B-1	Gray marble base, 12" polished	Very Significant Qnty:	
M-16	Marble window sill, original, with molded wood skirt	Contributory Qnty:	
M-6	Metal wood-grained casing w/ fancy profile	Non-Contributory Qnty:	
P-10	Toilet, Non-original	Non-Contributory Qnty:	
P-12	Urinal, Non-original	Non-Contributory Qnty:	
P-13	Porcelain sink	Non-Contributory Qnty:	
H-1	Brass door handle, modern	Contributory Qnty:	
W-13	Wallpapered wall, bookcloth/burlap	Contributory Qnty:	
E-14	fan	Non Contributory Qnty:	
F-2	Tile floor, hex & square, mosaic	Significant Qnty:	
H-3	Brass door handle, old or original	Contributory Qnty:	
HC-6	Thermostat	Non Contributory Qnty:	
L-08	Fluorescent lights	Non Contributory Qnty:	

W-16	Toilet partition/compartment	Non Contributory Qnty:
W-19	white onyx travertine wall	Very Significant Qnty:
WN-1	Aluminum replacement window	Non Contributory Qnty:
W-8	Sheetrock wall, painted and smooth	Contributory Qnty:
WN-3	Interior transom	Contributory Qnty:

412

Dimension/S F

Original Use hallway

Preservation Level II 2



Notes Includes 412a-f, There are various electric boxes throughout the offices.

Element	Description	Historical Significance	Notes
B-6	Plaster base, painted	Very Significant Qnty:	
B-2	Molded wood base	Contributory Qnty:	
CL-08	Acoustical ceiling, suspended T-bar frame	Non-Contributory Qnty:	
D-07	Wood Panel door with decorative metal wood-grained casing	Contributory Qnty:	possibly original
D-19	Wood slab door with plain metal casing. (demountable wall doors)	Contributory Qnty:	to closet area
F-14	Carpet tiles	Non-Contributory Qnty:	
L-08	Fluorescent lights	Non-Contributory Qnty:	
W-14	Wallpapered wall	Non-Contributory Qnty:	vinyl wall covering
W-18	demountable wall	Non Contributory Qnty:	used as division walls, except at the storage room
W-7	Plaster wall, painted and smooth	Contributory Qnty:	all perameter walls and storage area
W-8	Sheetrock wall, painted and smooth	Contributory Qnty:	storage area division. And most east wall
WN-1	Aluminum replacement window	Non-Contributory Qnty:	Succ Hall
WN-11	Metal transom, louvered	Significant Qnty:	above entry door only

424 Office/ Legislative Research

Dimension/S F

Original Use Architecture

Preservation Level II 2



Notes This description includes 424a, 426 and 426a which were accountancy offices.

Element	Description	Historical Significance	Notes
D-19	Wood slab door with plain metal casing. (demountable wall doors)	Qnty:	
F-11	Carpeted floor, on pad	Contributory Qnty:	
M-6	Metal wood-grained casing w/ fancy profile	Non-Contributory Qnty:	
WN-3	Interior transom	Contributory Qnty:	
B-4	Rubber/vinyl base	Non-Contributory Qnty:	
B-6	Plaster base, painted	Contributory Qnty:	
CL-08	Acoustical ceiling, suspended T-bar frame	Non-Contributory Qnty:	
D-04	Wood panel door, decorative metal wood- grained casing, transom above	Contributory Qnty:	
L-08	Fluorescent lights	Non Contributory Qnty:	
W-7	Plaster wall, painted and smooth	Contributory Qnty:	
W-8	Sheetrock wall, painted and smooth	Contributory Qnty:	
WN-1	Aluminum replacement window	Non Contributory Qnty:	Along exterior wa
D-09	Wood slab door with decorative metal-wood grained casing, transom above	Contributory Qnty:	
M-16	Marble window sill, original, with molded wood skirt	Contributory Qnty:	